



6S10 6S20 6S30 6S11 6S21

Size <ligne>	15'''
Height <mm>	4.90
Accuracy <per Month>	±20 sec
Battery Life	4 years (6S21 3 years)

Battery consumption could be minimum by pulling out the stem

Balance Weight <μN · m>	Minute 1.00 Second 0.40 Small 0.04
----------------------------	--





Clearance	
Clearance changes subject to the glass, case structure, and the length of the hand.	

Original Package	200 pcs
------------------	---------

Time measurement

Accuracy

The unit (gate) time of measurement must be set at "10 sec." and the measurement must be performed in the form of complete watch.

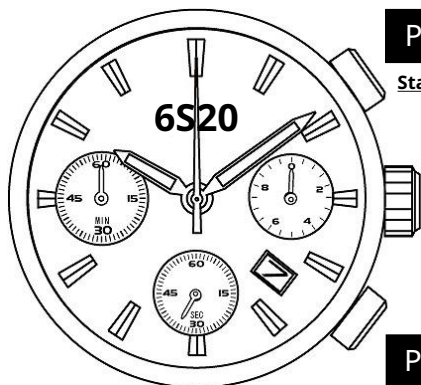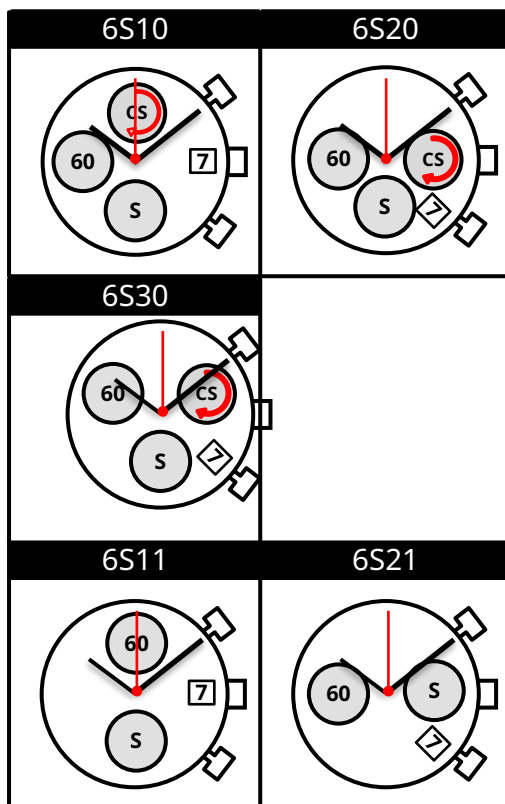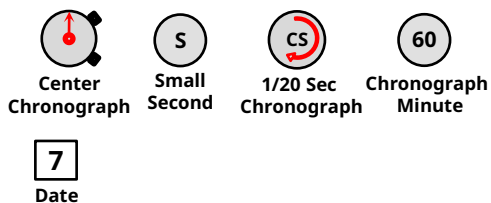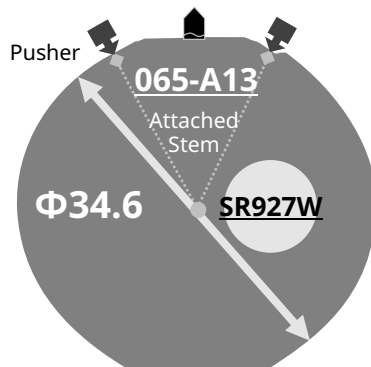

Push "A"

Start and Stop the chronograph

Push "B"

Reset the chronograph

Setting the Date

DO NOT set Date between 9:00pm - 1:00am

Setting the Time

Set CHRONOGRAPH hands to reset

Push A or B to set the hands to the zero position. The chronograph hands can be advanced rapidly by continuously pressing button.

A for the Center Chronograph Second hand, B for 1/20 hands