
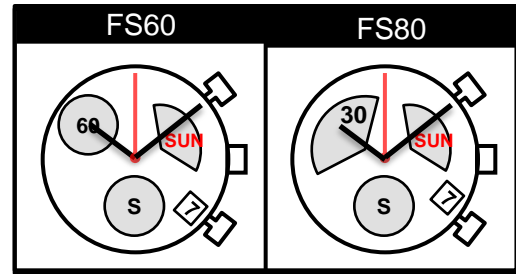
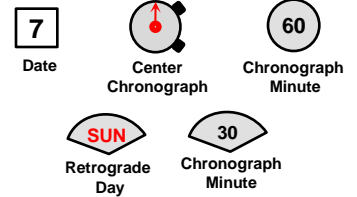


Size <ligne>	10 ½”
Height <mm>	5.10
Accuracy <per Month>	±20 sec
Battery Life	2 years

*60 minutes chronograph operation per day

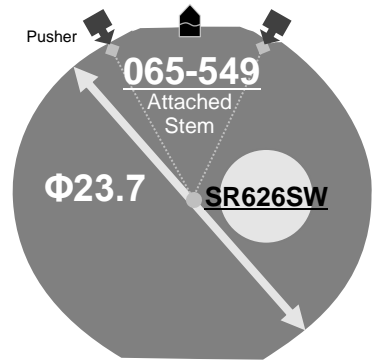


Parallel Push Button Ver.
FS61
FS81

Battery consumption could be minimum by pulling out the stem

Balance Weight <μN.m>	Minute 0.40 Second 0.08 (FS80 0.035) Small 0.02 Day Hand 0.04
---------------------------------	---

Featured by Shock Detection(FS60/61)

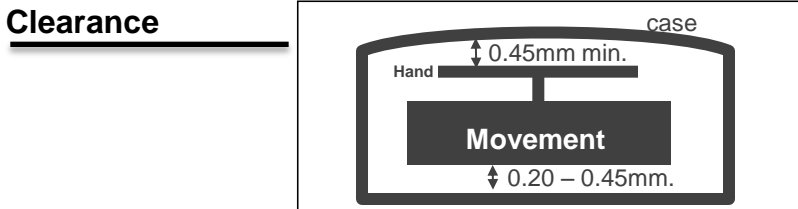


Original Package	500pcs
-------------------------	--------

Time measurement

Accuracy

The unit (gate) time of measurement must be set at "10 sec." and the measurement must be performed in the form of complete watch.

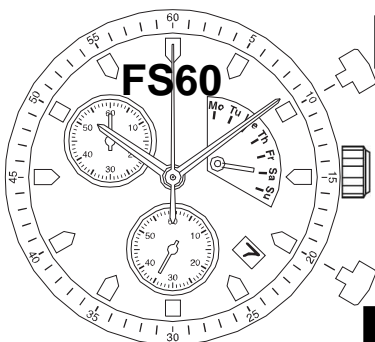

Push "A"

Start and Stop the chronograph

Setting the Time

Set CHRONOGRAPH hands to reset

Push A to reset the hands position to the ZERO position,
And continue to push A to put them forward

Push "B"

Reset the chronograph

Setting the Date

DO NOT set Date between 9:00pm - 1:00am
DO NOT set Day between 11:00pm - 2:00am